

# **TOPEX/Poseidon MGDR** Quality Assessment Report

# Cycle 447

# 01-11-2004 / 11-11-2004

Prepared by :	C. Schgounn, CLS	
	G. Pontonnier, CLS	
	M. Ablain, CLS	
Accepted by :	J. Dorandeu, CLS	
Quality visa :	M. Destouesse, CLS	
Approved by :	N. Picot, CNES	







SALP-RP-P2-EX-21120-CLS447 Edition 01.0, March 2005

# 1 Introduction. Document overview

The purpose of this document is to report the major features of the data quality from the Topex/Poseidon mission. The document is associated with data dissemination on a cycle by cycle basis.

The objectives of this document are :

To provide a data quality assessment To provide users with necessary information for data processing

To report any change likely to impact data quality at any level, from instrument status to software configuration

To present the major useful results for the current cycle

It is divided into the following topics:

Cycle overview CALVAL main results

# 2 Cycle overview

# 2.1 Cycle quality and performances

Data quality for this cycle is nominal.

For this cycle, the crossover standard deviation is 6.63 cm rms. When using a selection to remove shallow waters (1000 m), areas of high ocean variability and high latitudes (> |50| deg.) it decreases down to 5.73 cm rms.

The standard deviation of Sea Level Anomalies (SLA) relative to a 7-year Mean Sea Surface is 11.45 cm. When using a selection to remove shallow waters (1000 m), areas of high ocean variability and high latitudes (> |50| deg), it lowers to 9.95 cm.

### 2.2 Missing measurements

This cycle has no missing pass.

### 2.3 Warnings and recommendations

- Missing measurements :
  - Since October 08th all mission data recovery requirements have been met via TDRSS real time contacts.

Therefore there is a lot of data gaps, especially in the Indian Ocean, between the East and Southeast Pacific basin, in the South Pacific Ocean close to the South and Central America coasts and below the Groenland coasts.

- Doris switch off :
  - The DORIS instrument experienced an incident on 01, November 2004.

Commands were send to the instrument but the instrument did not respond as espected.

The DORIS instrument was switched from the redundant side on 16, November but all commands send was unsuccessful in returning the instrument in nominal operations.


Therefore from this incident all the POE requirements will be met using lasernet tracking data.

• Measurements edited by the TMR parameters :

The following anomalies are explained by the problems in the interpolation of the TMR parameters due to tape recorder failures :

- 6.35% of the measurements are removed by the TMR correction criterion (see the following figure).
- All measurements of passes 181, 189 and 233 are removed by the radiometer land flag criterium.
- Some measurements have radiometer earth flag set to valid over earth. A new criterion has been added to the editing procedure to remove all these measurements (see **Editing**).

Edited parameter : Radiometer wet tropospheric correction T/P Cycle 447 (01/11/2004 / 11/11/2004)

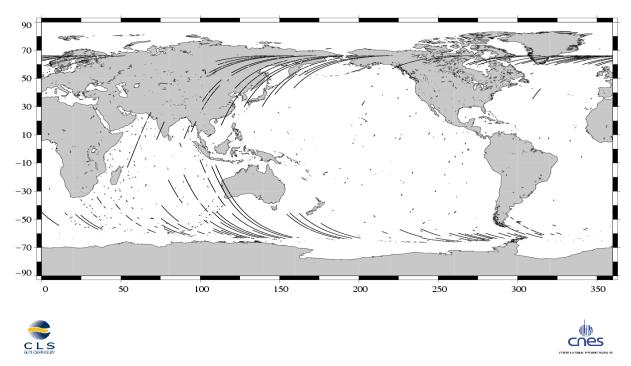


# 3 CALVAL main results

This section presents results that illustrate data quality during this cycle. These verification products are produced operationally so that they allow systematic monitoring of the main relevant parameters.

## 3.1 Missing measurements

599217 altimeter measurements are present, and 195438 are missing.

The map below shows all the available measurements for this cycle and illustrates the tape recorder problems. The latter figure shows missing 1Hz measurements in the GDRs, with respect to a 1 Hz sampling of a nominal repeat track.

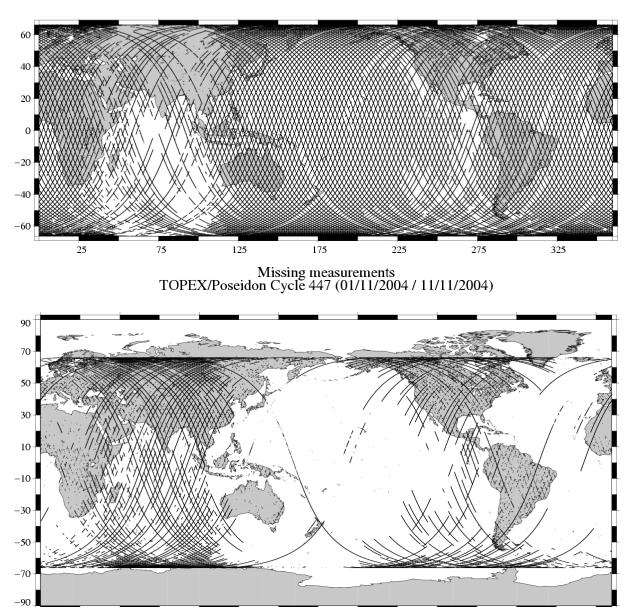

Available measurements TOPEX Cycle 447 (01/11/2004 / 11/11/2004)

TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447

200

250

300

350

150

100


50

0

# 3.2 M-GDR quality flags


The following table indicates the percentage of measurements for which those flags are set.


Name	Descrition	% bad
Geo_Bad_1	altimeter land flag	24.45
Geo_Bad_1	ice flag	7.28
Geo_Bad_1	radiometer land flag	26.28
Alt_Bad_1	conditions 1 altimeter	4.84
Alt_Bad_2	conditions 2 altimeter	4.70
Geo_Bad_2	rain (liquid water in excess)	10.81
Geo_Bad_2	less than 4 points for CSR3.0 tide calculation	0.38
Geo_Bad_2	less than 4 points for FES95.2.1 tide calculation	2.89
TOPEX	TOPEX not valid	0.00
TMR	TMR not valid	0.00
TMR_Bad	Brightness temperatures not valid	13.31
DORIS	DORIS not valid	0.00

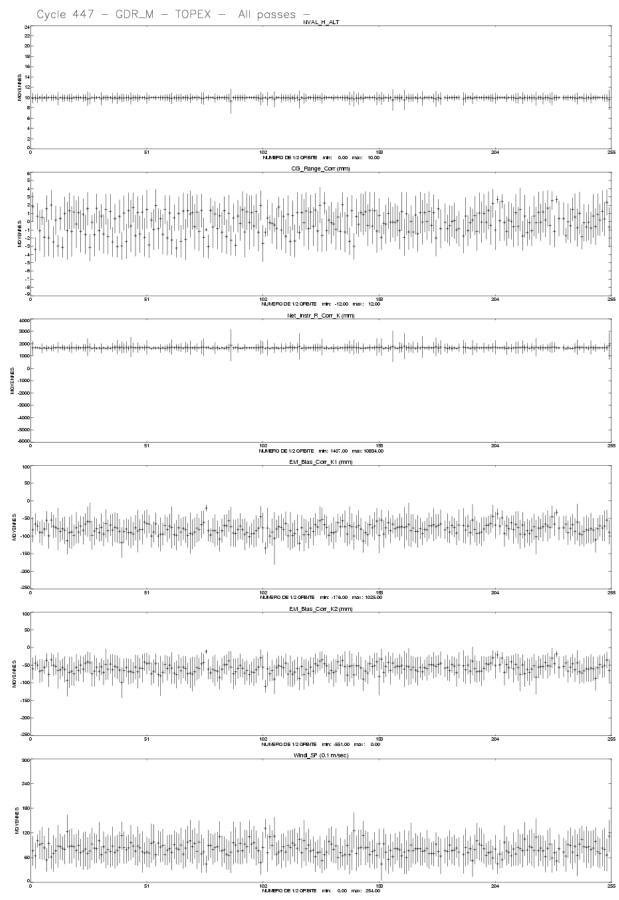


## **3.3** M-GDR parameter plots


TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447

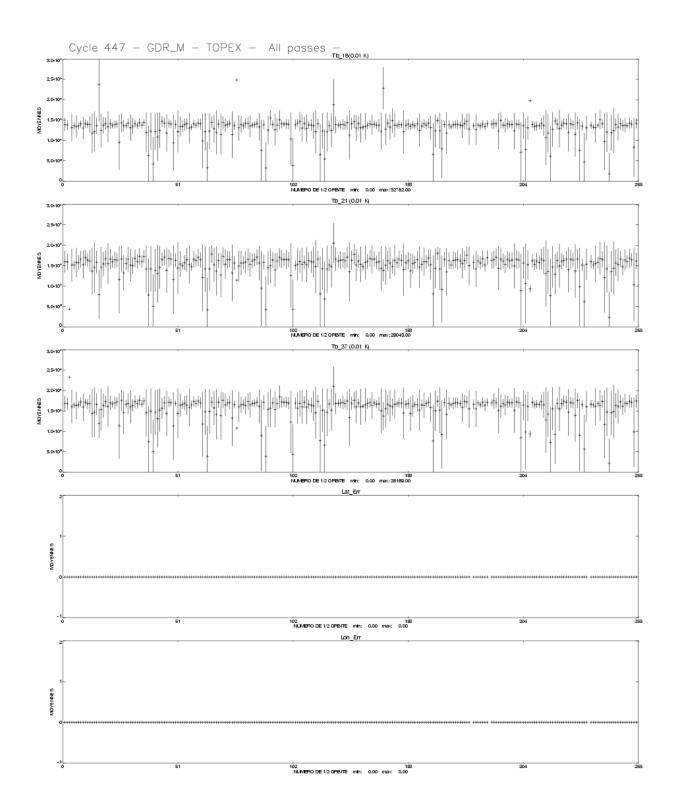


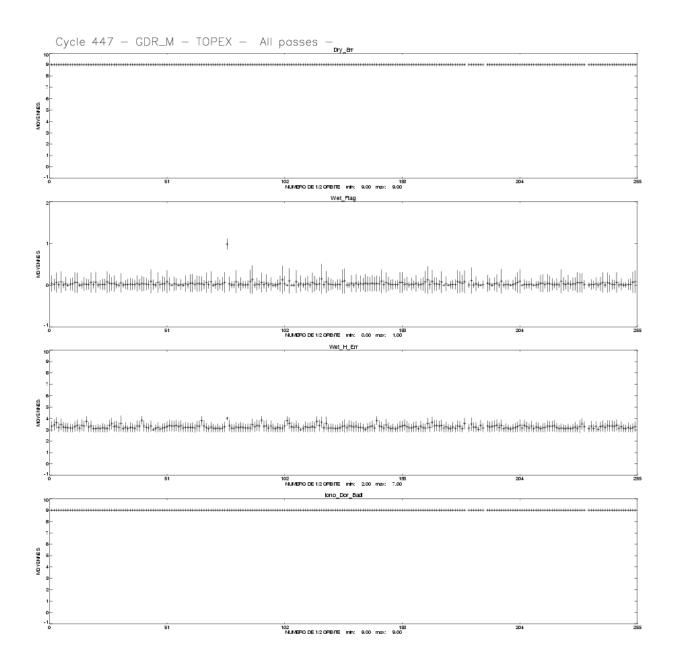

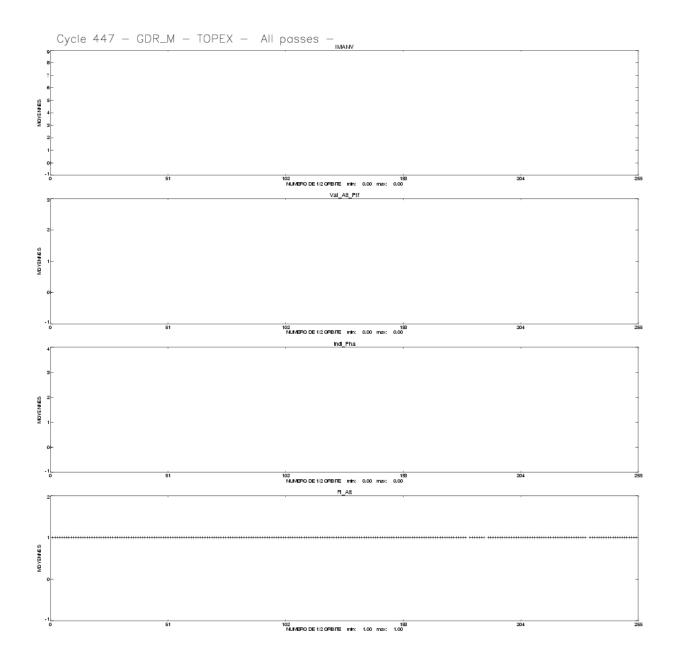




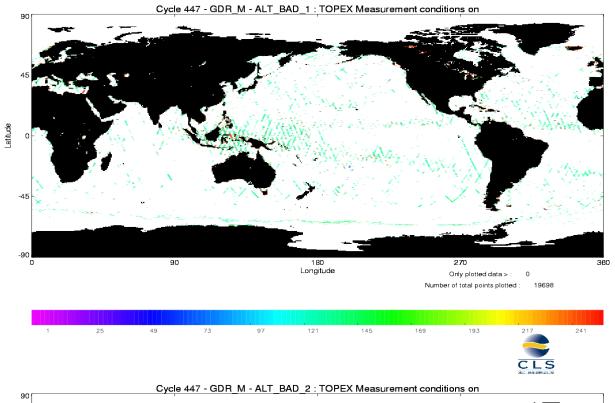

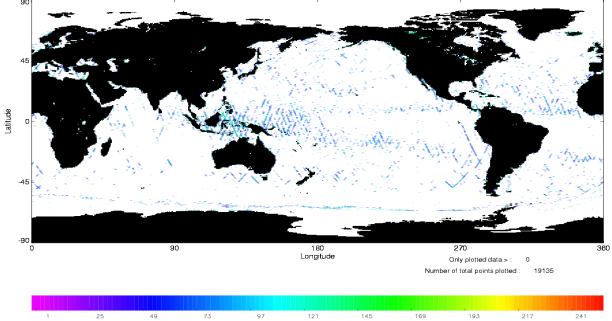




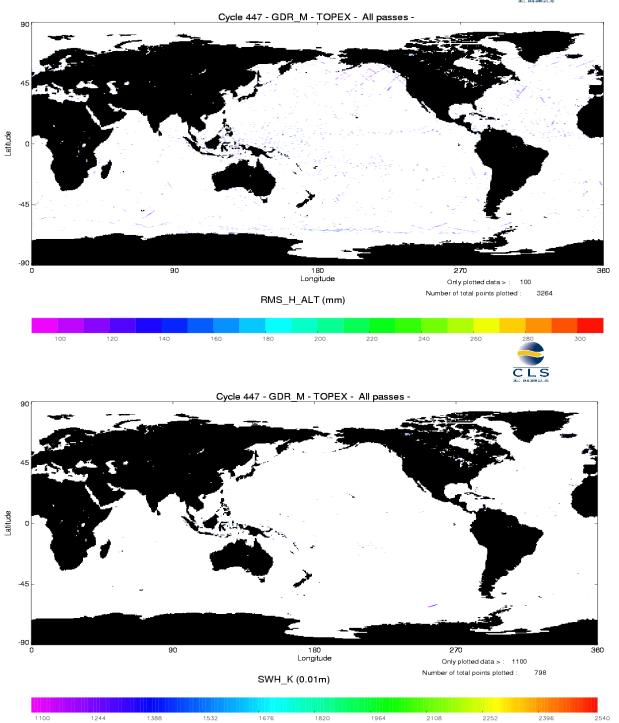



Cycle 447 - GDR\_M - All passes - DORIS instrument states

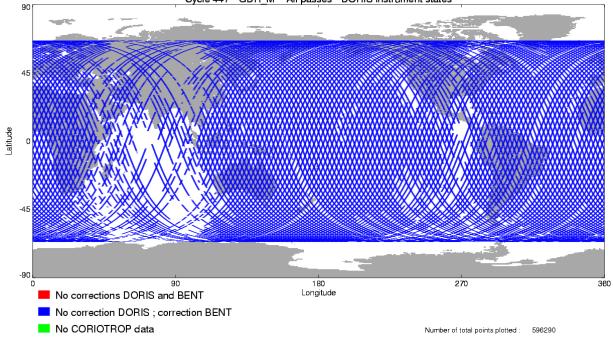

# 3.4 Editing

The following table gives for each tested parameter, minimum and maximum thresholds, the number and the percentage of points removed. As a comparison, the mean percentage over one year (1997) is also given.


There are problems in the interpolation of the TMR parameters since cycle 371 when there are missing measurements (tape recorder failures). These bad measurements are removed by the TMR correction criterion but some of them have been kept. Thus a new criterion has been added to the editing procedure since the cycle 376 to remove all the mesurements where the absolute value of the difference between the TMR correction and the ECMWF model wet tropospheric correction is greater than 20 cm.

Probably due to the interpolation problem with the TMR, some measurements have radiometer land flag unset over land. This has no impact on the valid data because these measurements have been edited by the altimetric parameter criteria. Nevertheless, this anomaly leads to wrong statistics of the edited measurements. Therefore a new criterion has been added in the editing procedure to remove all the measurements for which the radiometer land flag is set to ocean and the altimeter land flag is set to land.

The number and percentage of points removed by each criterion is given on the following table. Note that these statistics are obtained with measurements already edited for radiometer land flag (26.56 % of points removed) and ice flag (7.37 % of points removed).

Parameters	Min	Max	Unit	Mean %	% removed
	Thres.	Thres.		removed in	
				1997	
Sea surface height	-130.000	100.000	m	1.37	0.14
Number of 20/10Hz valid points Po-	5.000	-		1.37	0.23
seidon/TOPEX					
Std. deviation of range	0.000	0.100	m	1.85	0.83
Off nadir angle from waveform	0.000	0.400	deg	1.36	3.34
Dry tropospheric correction	-2.500	-1.900	m	0.00	0.00
Invert barometer correction	-2.000	2.000	m	0.00	0.00
TMR wet tropospheric correction	-0.500	-0.001	m	0.34	6.35
Ionospheric correction (Posei-	-0.400	0.040	m	0.00	0.25
don:Doris, TOPEX:Dual)					
Significant wave height	0.000	11.000	m	1.46	0.09
Sea state Bias	-0.500	0.000	m	1.39	0.15
Backscatter coefficient	7.000	30.000	dB	1.44	0.16
Ocean tide height	-5.000	5.000	m	0.01	0.15
Earth tide	-1.000	1.000	m	0.00	0.00
Pole tide	-15.000	15.000	m	0.00	0.00
TMR and ECMWF tropospheric	-0.200	0.200	m	NaN	0.53
differences					
Spline fitting					0.01

The following three maps are complementary: they show respectively the removed, the selected measurements and the percentage of selected measurements in the editing procedure.

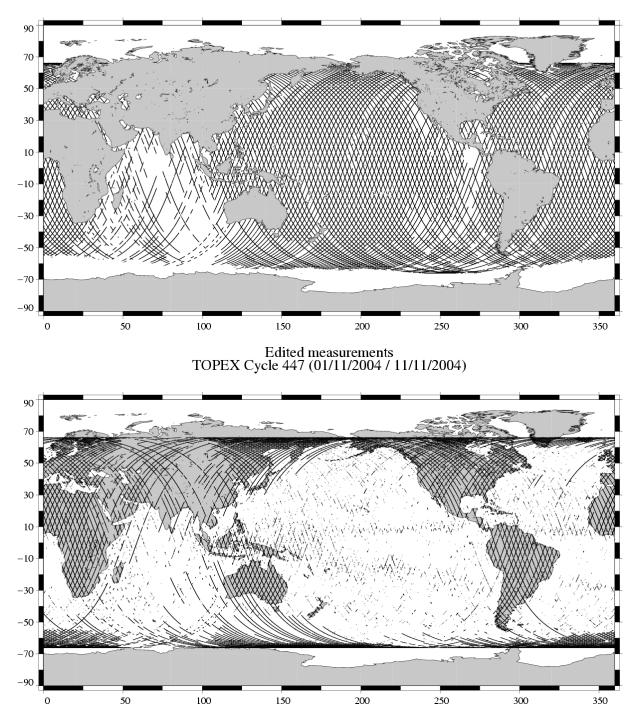


Valid data TOPEX/Poseidon Cycle 447 (01/11/2004 / 11/11/2004)


TOPEX/Poseidon GDR Quality Assessment Report Cycle 447 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447

Page 14

#### Percentage of valid data relative to the nominal pass TOPEX/Poseidon Cycle 447 (01/11/2004 / 11/11/2004)

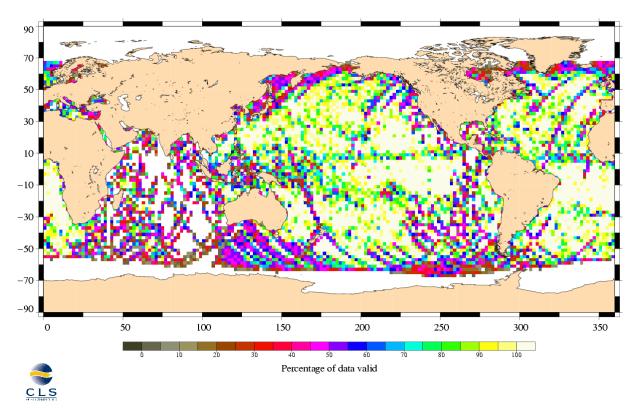



## 3.5 Ionospheric correction

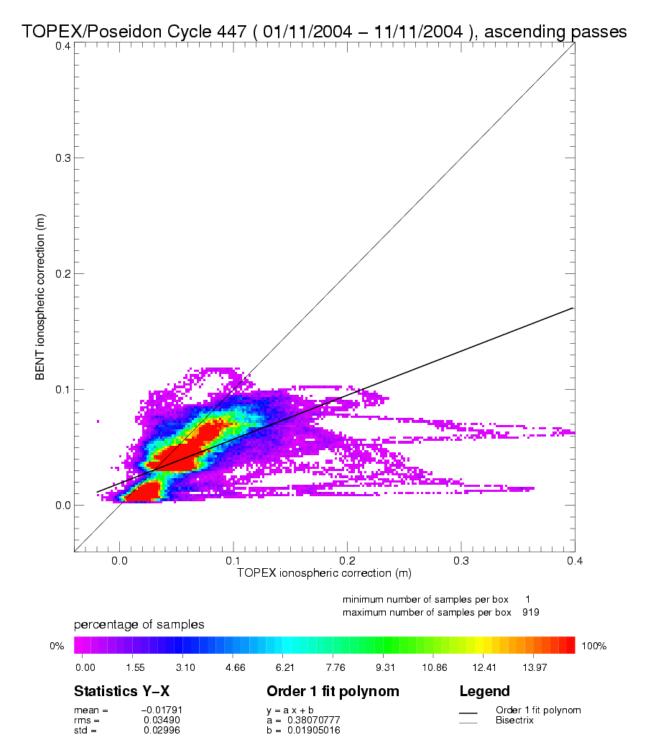

TOPEX/Poseidon GDR Quality Assessment Report Cycle 447 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447


Page 16

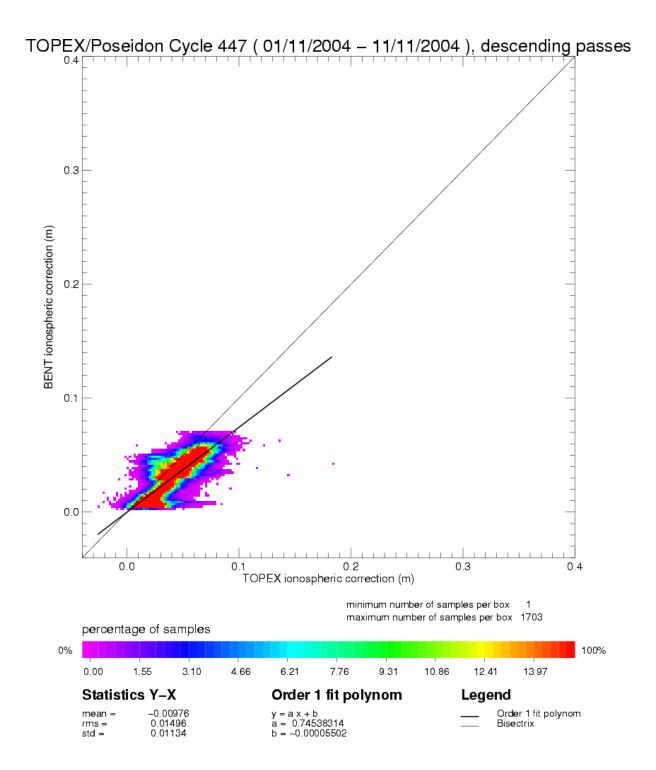

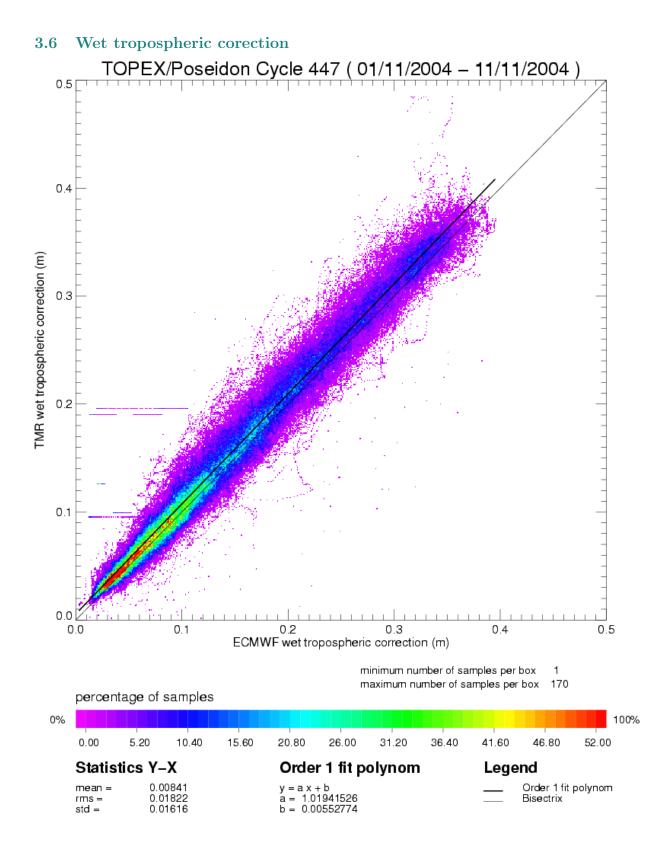



TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447

# 3.7 Crossover statistics

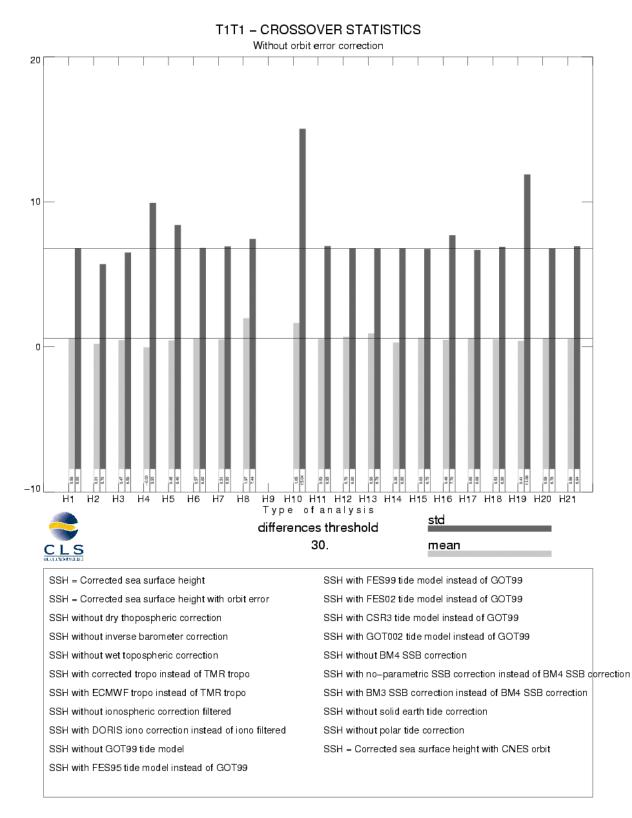


TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447 Page 19

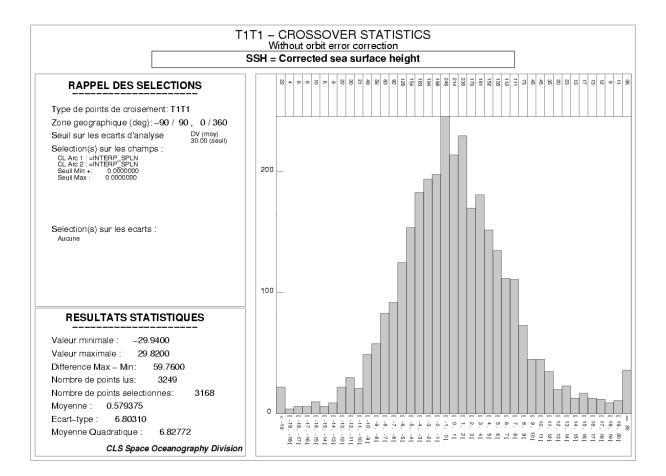

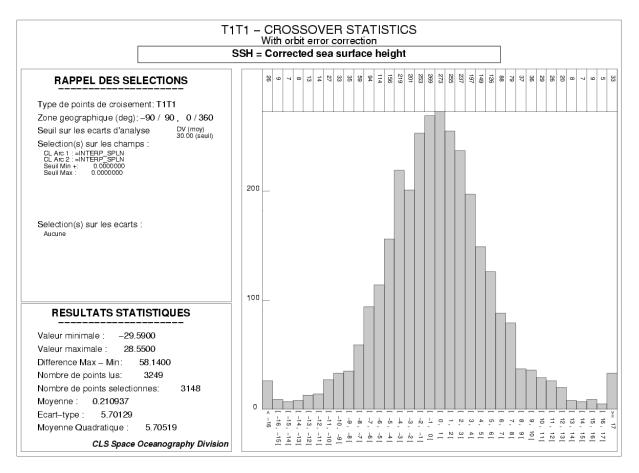


TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447 Page 20

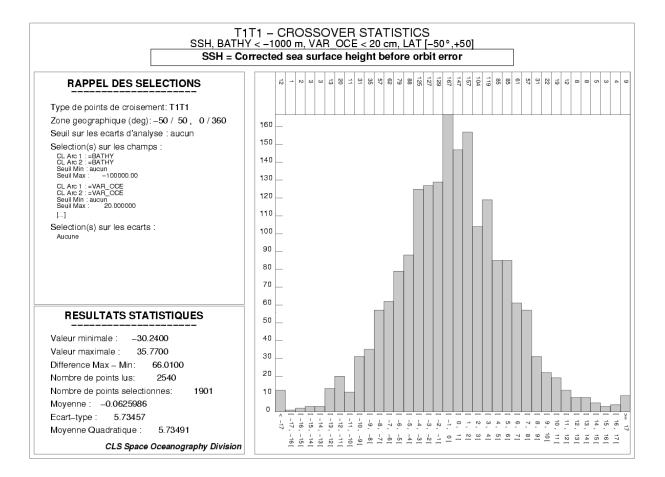


## 3.8 SSH variability

#### 3.8.1 Sea Level Anomaly

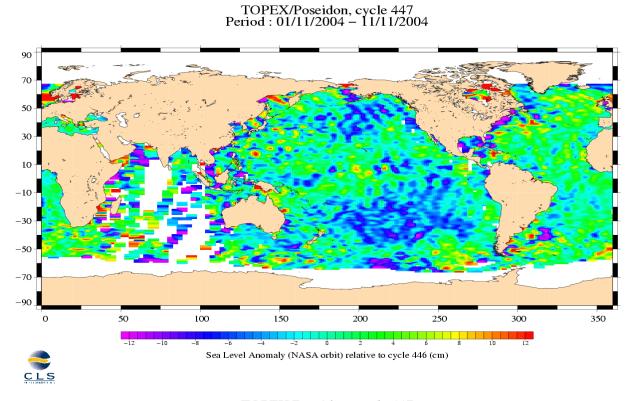


TOPEX/Poseidon, cycle 447 Period : 01/11/2004 – 11/11/2004

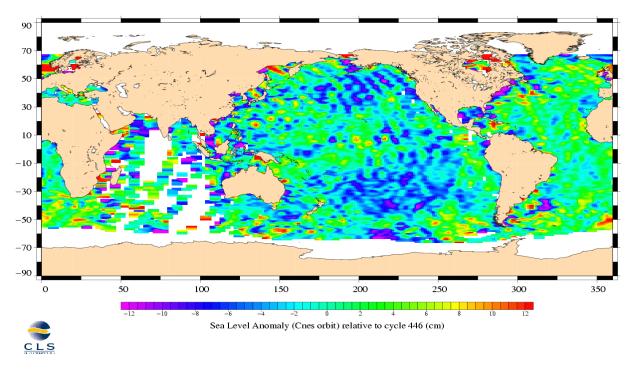


#### TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447 Page 22

#### TOPEX/Poseidon, cycle 447 Period : 01/11/2004 – 11/11/2004

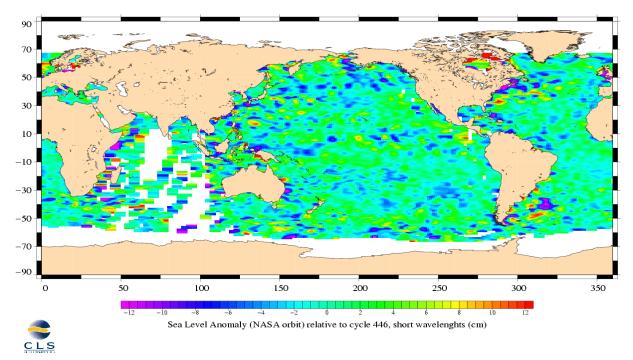

#### 3.8.2 Comparison to a precise Mean Sea Surface


The CLS (2001) MSS model is used as a reference to compute SLA. The two following maps respectively show the map of Topex SLA relative to the MSS and differences higher than a 30 cm threshold (after centering the data). The latter figure shows that higher differences are located in high ocean variability areas, as expected.

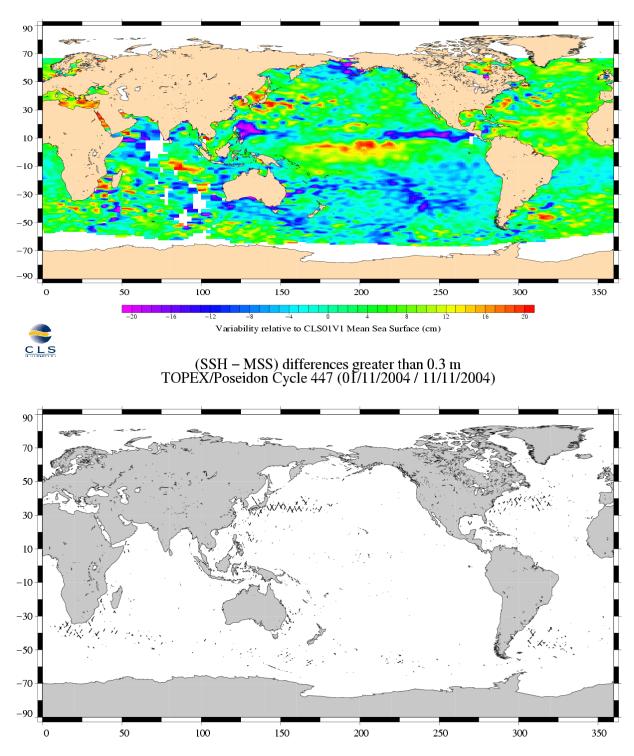


TOPEX/Poseidon, cycle 447 Period : 01/11/2004 – 11/11/2004

TOPEX/Poseidon GDR Quality Assessment Report **Cycle 447** 01-11-2004 11-11-2004 SALP-RP-P2-EX-21072-CLS447 Page 24

# 3.9 Dynamic topography

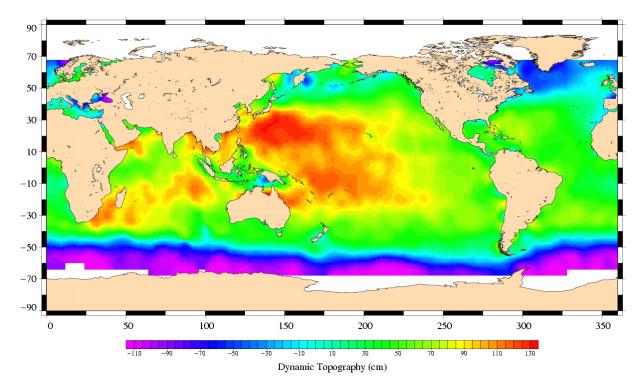



#### 3.10 Wind and wave maps

These two figures show wind and wave estimations derived from 10 days of altimeter measurements.

